

## Informations techniques/Technical Matters


October 7th, 1971.

SUBJECT: BOSCH STARTERS FOR BSE ENGINES.

A modification is required to install standard Bosch starters on BSE engines. Refer to attached sketch.

- a) The shoulder of the main body of the starter must be machined to 2.380" (original is 2.436").
- b) The mounting hole at the bottom must be redrilled to 13/32" in lieu of .338".

In view of this modification, a starter installed on a BSE engine is not replaceable by a standard Bosch starter.

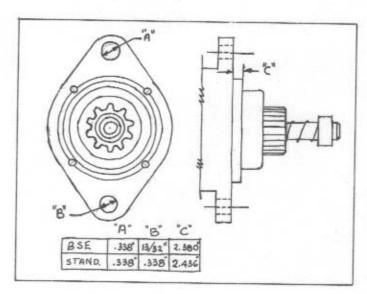

RL/cm

Technical Information Department.